



Iridium 9555

Software Release Note

HT25003

IRDM-1023-SRN-002 | v6.3 | rACC28CAACA | 2025-NOV-18

LEGAL DISCLAIMER AND CONDITIONS OF USE

Use of the product (the "Product") described in this document (the "Document"), the information provided in this Document, and this Document itself is governed by and subject to the terms, licenses and restrictions of your Agreement with Iridium. Please review that Agreement. This Document is Iridium proprietary business information. Consistent with your Agreement with Iridium, you may not disclose this Document to others without express prior written permission from Iridium. Any violation of your Agreement's Proprietary and Confidentiality obligations shall result in remedies to the fullest extent available to Iridium at law or in equity.

Reasonable effort has been made to make the information in this Document reliable and consistent with other specifications, test measurements and other information. However, Iridium Satellite LLC and its affiliated companies, directors, officers, employees, agents, trustees or consultants ("Iridium") assume no responsibility for any typographical, technical, content or other inaccuracies in this document. Iridium reserves the right in its sole discretion and without notice to you to change this Document and materials and/or revise this Document or withdraw it at any time. You assume any and all risks of using the Product and any information provided in this Document.

IRIDIUM MAKES NO REPRESENTATIONS, GUARANTEES, CONDITIONS OR WARRANTIES, WHETHER EXPRESS OR IMPLIED, INCLUDING WITHOUT LIMITATION, IMPLIED REPRESENTATIONS, GUARANTEES, CONDITIONS OR WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, NON-INFRINGEMENT, SATISFACTORY QUALITY, NON-INTERFERENCE, ACCURACY OF INFORMATIONAL CONTENT, OR THOSE ARISING FROM OR RELATED TO A COURSE OF DEALING, LAW, USAGE, OR TRADE PRACTICE OR ARISING FROM OR RELATED TO THE PERFORMANCE OR NONPERFORMANCE OF THE PRODUCT OR THIS DOCUMENT. ANY OTHER STANDARDS OF PERFORMANCE, GUARANTEES, CONDITIONS AND WARRANTIES ARE HEREBY EXPRESSLY EXCLUDED AND DISCLAIMED TO THE FULLEST EXTENT PERMITTED BY LAW. THIS DISCLAIMER AND EXCLUSION SHALL APPLY EVEN IF THE EXPRESS LIMITED WARRANTY AND DOCUMENTATION FOR THE PRODUCT FAILS OF ITS ESSENTIAL PURPOSE.

IN NO EVENT SHALL IRIDIUM BE LIABLE, REGARDLESS OF LEGAL THEORY, INCLUDING WITHOUT LIMITATION CONTRACT, EXPRESS OR IMPLIED WARRANTY, STRICT LIABILITY, GROSS NEGLIGENCE OR NEGLIGENCE, FOR ANY DAMAGES IN EXCESS OF THE PURCHASE PRICE OF THE PRODUCT, IF ANY. NOR SHALL IRIDIUM BE LIABLE FOR ANY DIRECT, INDIRECT, INCIDENTAL, SPECIAL OR CONSEQUENTIAL DAMAGES OF ANY KIND, LOSS OF REVENUE OR PROFITS, LOSS OF BUSINESS, LOSS OF PRIVACY, LOSS OF USE, LOSS OF TIME OR INCONVENIENCE, LOSS OF INFORMATION OR DATA, SOFTWARE OR APPLICATIONS OR OTHER FINANCIAL LOSS CAUSED BY THE PRODUCT (INCLUDING HARDWARE, SOFTWARE AND/OR FIRMWARE) AND/OR THE IRIDIUM SATELLITE SERVICES, OR ARISING OUT OF OR IN CONNECTION WITH THE ABILITY OR INABILITY TO USE THE PRODUCT OR ANY OTHER IRIDIUM PRODUCTS (INCLUDING HARDWARE, SOFTWARE AND/OR FIRMWARE) AND/OR THE IRIDIUM SATELLITE SERVICES TO THE FULLEST EXTENT THESE DAMAGES MAY BE DISCLAIMED BY LAW AND WHETHER IRIDIUM WAS ADVISED OF THE POSSIBILITIES OF SUCH DAMAGES. IRIDIUM IS NOT LIABLE FOR ANY CLAIM MADE BY A THIRD PARTY OR MADE BY YOU FOR A THIRD PARTY.

LIMITED LICENSE TO SOFTWARE/FIRMWARE

The Product may contain software, including firmware and software made available by one or more third parties (the "Software.") To the extent it does, each such item of software is subject to the applicable terms and conditions (the "Software Terms") available at https://www.iridium.com/resources/?fwp_resource_categories=legal-notice. Do not use the Product until you have carefully read the Software Terms. Do not use the Product if you do not wish to agree to the Software Terms. Your use of the Product constitutes your acceptance of all of the Software Terms. Without limiting the foregoing, if you do not agree to the Software Terms, you are not granted any license or rights whatsoever to use the software contained on the Product.

EXPORT COMPLIANCE INFORMATION

This document or item contains information subject to the Export Administration Regulations (EAR) (15 CFR 730-774). It may not be exported, disclosed, or transferred to any foreign person without the applicable prior authorization of the U.S. Department of Commerce. Violations may result in civil or criminal penalties. ECCN: EAR99

Table of Contents

1. Introduction	3
1.1. Upgrade Tool OS Compatibility	3
2. Upgrade Warnings	4
2.1. Phonebook	4
2.2. Inability to Downgrade	4
3. Performing the Upgrade	5
3.1. Typical Upgrade	5
3.2. Troubleshooting USB Drivers	6
4. Hardware Compatibility	7
5. Change List	8
5.1. HT25003	8
5.2. HT25001	8
5.3. HT21001	8
5.4. HT19002	9
5.5. HT18001	9
5.6. HT17001	10
5.7. HT15002	10

1. Introduction

This document details the use of the Iridium 9555 software upgrade tool and lists the feature changes contained within the version HT25003 release.

1.1. Upgrade Tool OS Compatibility

The upgrade tool that accompanies this release has been tested with Microsoft Windows 11. The instructions that follow in this document assume the use of this version of Microsoft Windows.

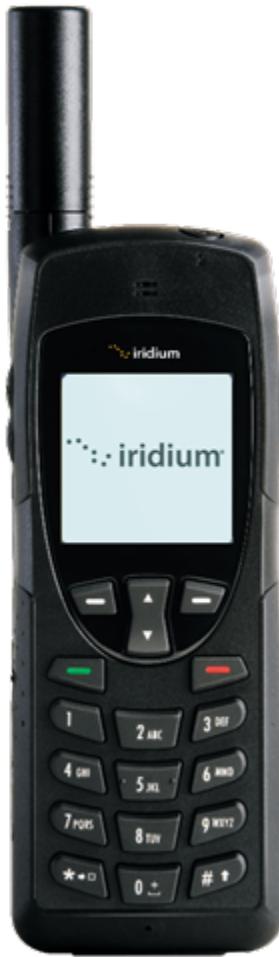


Figure 1. Iridium 9555 Handset

2. Upgrade Warnings

2.1. Phonebook

All non-volatile user information in the handset will be erased when upgrading an Iridium 9555 handset from software versions earlier than release candidate HT14004. This includes for example the phonebook entries and lifetime use counters.

This section is not applicable to handsets that have already been upgraded to HT15002 or later and performed the datastore reformat as described below.

After the upgrade from HT14004 or earlier is complete the user must reformat the datastore file system to make it compatible with HT25003. To do this, the user must navigate to the idle screen and enter the short code:

```
*#323#<green>
```

Where <green> means to press the green button on the handset.

The handset will then reboot.

If a user tries to access the phonebook without performing the steps presented above they will be presented with an error stating “My Phonebook failed to initialize. Contact service center.” The datastore file system must be reformatted using the instructions above.

2.2. Inability to Downgrade

It is not possible to downgrade to a software version prior to HT15002 once an upgrade to HT15002 or later is performed.

3. Performing the Upgrade

The following steps should be used to upgrade an Iridium 9555 handset from version HT11001 or later.

- **Supported:** Models 9555A and 9555N
- **Not Supported:** Models 9555 non-A or older

3.1. Typical Upgrade

- Run the upgrade installer application.
 - The application is named "Iridium 9555 Software Upgrade HT25003 Installer.exe"
 - This will place the upgrade tool and USB drivers into the C:\Program Files\Iridium directory
- Prior to performing the upgrade complete the following:
 - Disable Bluetooth on the PC running the upgrade
 - Remove the SIM card from the handset and install the handset battery
 - Turn the handset on
 - Ensure that the battery is fully charged or a charger is connected to the handset
- Connect the handset to the PC using a USB cable.
 - If the handset is being connected to this PC for the first time, or to a USB port that has not been used before, the driver will be installed automatically. If this is the case, wait for Windows to show the "New Hardware Installed" notification before proceeding.
 - If Windows is unable to automatically locate the USB driver, it can be found at C:\Program Files\Iridium\9555\USB\VCOMPORT
- Run the Iridium 9555 Software Upgrade tool.
 - A shortcut to this application should be available in the Start Menu in the Iridium 9555 Software Upgrade folder
 - The target of the shortcut is C:\Program Files\Iridium\9555\Upgrade_Tool\Iridium 9555 Software Upgrade HT25003.exe
- Follow instructions presented by the upgrade tool user interface.
 - During the upgrade process the handset will display various information on the screen, including "Upgrading..."
 - At times the handset screen may go completely blank
 - Do not disconnect the handset or press any keys while the upgrade is in progress
 - At times the handset may display "Inconsistent firmware. Please run upgrade tool."
 - The upgrade process may take 20 minutes or more to complete

3.2. Troubleshooting USB Drivers

If the PC being used to drive the upgrade process has been used previously to update Iridium 9555 handsets there is a possibility that it may have an incompatible DFU driver already installed.

This condition may present itself with the following observables; when running the Iridium Software Upgrade Tool the upgrade will stop when the handset switches to DFU mode. The handset will report “Upgrade in progress”. The upgrade tool will report “Error - cannot locate handset.” Viewing the handset in the device manager will show that the driver appears to be installed appropriately.

To recover from this condition follow the procedure below.

- Reinstall the USB drivers
 - Having run the upgrade tool and gotten to the error condition reported in the previous section, do not remove the USB connection between the PC and the handset
 - Exit the Iridium 9555 Software Upgrade Tool
 - Launch “Device Manager” in Windows by clicking the Start menu and searching for the same name in “Search programs and files”
 - Expand “Universal Serial Bus controllers” if not already expanded
 - Right-click on “Iridium 9555 Handset in DFU Mode” and select Properties
 - If not logged in as an administrator, select “Change settings” on the General tab and enter the administrator credentials
 - On the Driver tab, select “Uninstall”
 - In the “Confirm Device Uninstall” window that appears, click the checkbox beside “Delete the driver software for this device.” and click OK
 - Disconnect the USB cable between the handset and the PC, wait 5 seconds for the PC to recognize the disconnection, and then reconnect the cable
 - When the PC recognizes the handset it will show up in the Device Manager in “Other devices”
 - Right-click on “Iridium 9555 Handset” and select Properties
 - If not logged in as an administrator, select “Change settings” on the General tab and enter the administrator credentials
 - On the General tab, select “Update Driver...”
 - Select “Browse my computer for driver software”
 - Search for driver software in this location: “C:\Program Files\Iridium\9555\USB\DFU” and select “Next”
 - Windows will report that it has successfully updated your driver software for Iridium 9555 Handset in DFU Mode
 - Click Close
 - Attempt the upgrade process as detailed in Section 3.1, “Typical Upgrade”

4. Hardware Compatibility

This software release has been tested to be compatible with the following hardware model - IRID0115A.

Iridium may produce and distribute hardware models loaded with software version HT25003 that are not indicated above at its sole discretion and without notice.

5. Change List

5.1. HT25003

DESCRIPTION
Changed the French translation of the "Calling <dest>" message on the handset display.

5.2. HT25001

DESCRIPTION
Support added to correctly update date and time, following the Iridium Re-epoch scheduled for Jan 2026.
The direct Internet feature is no longer available; the handset displays "Dial-Up Internet Restricted."

5.3. HT21001

DESCRIPTION
Added optional audible indication of network connectivity status changes. User-configured in Menu > Setup > Volume and Tones > Network Tone.
Deprecated support for 9555 model number IRID0015 (9555 non-A). If an upgrade of this model is attempted the user will be notified with a message indicating the software upgrade is not compatible with the handset.
Improved communication channel selection algorithm used when establishing a connection with the network in telephony mode.
Added stronger validation checking of periodic radio calibration changes before storing to persistent memory in telephony mode.

5.4. HT19002

DESCRIPTION
Leveraged enhancements offered by the Iridium NEXT constellation to improve network connectivity and improve reception of transceiver ring notifications from the core network.
Resolved an issue wherein when the user attempted to enter the SMS menu when the outbox on the SIM was full the handset would reboot.
Fixed an issue preventing display of predictive help content.
Corrected an issue preventing display of software version in French.
Updated Iridium branding content in Upgrade Tool.

5.5. HT18001

DESCRIPTION
Initial production release for the Iridium 9555N.
Addressed an issue where channel assignments were inadvertently being discarded in some situations thereby improving overall handset performance.
Modified battery charging algorithm to ensure compliance with battery specifications.
Modified transceiver behavior to comply with the European Union Radio Equipment Directive in failure conditions.

5.6. HT17001

DESCRIPTION
Improved accuracy of reporting when SMS storage on the SIM has reached capacity.
Updated startup splash screen to display a NEXT constellation satellite.
Improved handset upgrade: added support for Windows 10; required drivers are now installed automatically; and the upgrade itself is faster in some situations.
Added functionality to allow short codes to be stored in the phonebook, used from the phonebook, and dialed directly.
Improved the translations for some non-English menu languages and added Kurdish (Sorani) as a new language option.
Improved responsiveness to power button press to turn the handset off.
Improved reporting of signal strength on the user interface and the AT interface.
Fixed an issue where a remote DTMF button press could unmute a local handset.
Use of SBD services is now permitted when no SIM card is present in the handset.

5.7. HT15002

DESCRIPTION
Calls to the emergency services number “000” are now permitted when no SIM card is present in the handset.
Added necessary conversions for display of time on user interface in Iridium network era 2 and other era detection and transition improvements.
Corrected an issue that would arise when the handset was transmitting and receiving SMS messages at the same time.